



655 Eisenhower Drive
Owatonna, MN 55060 USA
Phone: (507) 455-7000
Tech. Serv.: (800) 533-6127
Fax: (800) 955-8329
Order Entry: (800) 533-6127
Fax: (800) 283-8665
International Sales: (507) 455-7223
Fax: (507) 455-7063
Website: www.otctools.com

Form No. 107092


Operating Instructions for:

**6468
(511535)**


Ford Camshaft Pulley Holding Tool

Application: 1993 – 1997 Ford Probe w/ 2.0L, 4 cyl., engine


Note: Same as Ford No. 303-398 (T92C-6256-AH).

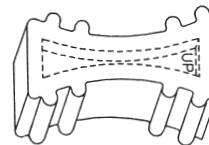


1. Rotate engine to align camshaft timing marks with crankshaft timing marks.

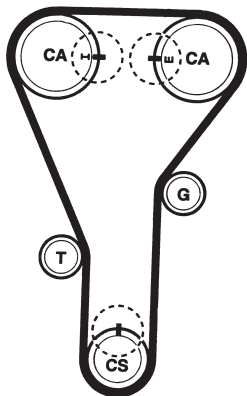

2. Insert No. 6468 (511535) between intake and exhaust cam pulleys. The tool will fit correctly only one way. The side of tool marked UP must be facing the technician and top of engine.

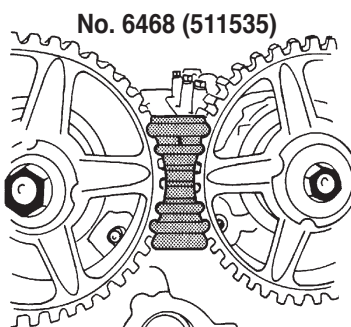

3. Follow vehicle service manual procedure to service timing belt as required. Remove tool when finished.

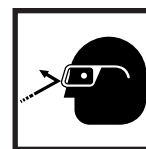

WARNING: Wear eye protection that meets ANSI Z87.1 and OSHA standards.

Rev. C, January 19, 2015
© Bosch Automotive Service Solutions Inc.



655 Eisenhower Drive
Owatonna, MN 55060 USA
Phone: (507) 455-7000
Tech. Serv.: (800) 533-6127
Fax: (800) 955-8329
Order Entry: (800) 533-6127
Fax: (800) 283-8665
International Sales: (507) 455-7223
Fax: (507) 455-7063
Website: www.otctools.com

Form No. 107092


Operating Instructions for:

**6468
(511535)**


Ford Camshaft Pulley Holding Tool

Application: 1993 – 1997 Ford Probe w/ 2.0L, 4 cyl., engine


Note: Same as Ford No. 303-398 (T92C-6256-AH).

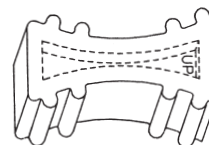


1. Rotate engine to align camshaft timing marks with crankshaft timing marks.

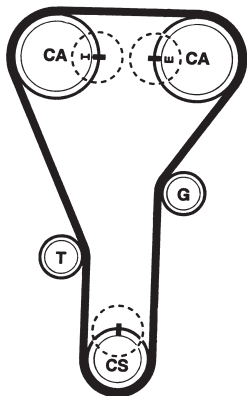

2. Insert No. 6468 (511535) between intake and exhaust cam pulleys. The tool will fit correctly only one way. The side of tool marked UP must be facing the technician and top of engine.

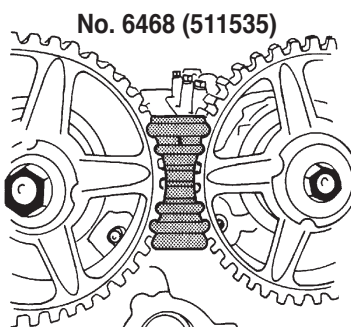

3. Follow vehicle service manual procedure to service timing belt as required. Remove tool when finished.

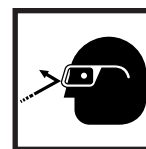

WARNING: Wear eye protection that meets ANSI Z87.1 and OSHA standards.

Rev. C, January 19, 2015
© Bosch Automotive Service Solutions Inc.